

Product Info TFP-42P, -52P, -62P, -162P, -182P

PHARMA

Pharma-Temperature Sensor M12 hygienic



Application/Specified usage

- · Temperature measurement in pipes DN15...DN80
- · Temperature measurement in thin-walled pipes and vessels

Application examples

- · Process monitoring
- · Monitoring of CIP-/SIP-process
- · Temperature measurement in hot steam pipes

Hygienic design/Process connection

- · Flow optimized, hygienic and easy sterilizable installation by sleeve, e.g. EMZ-032, or build-in system EHG-.../M12.
- Additional process connections:
 adapter for Tri-Clamp, dairy flange (DIN 11851), Varivent, DRD, APV et al.
- Sealing system free of elastomers, the connection will be without gaps and crevices
- · CIP-/SIP-cleaning up to 140 °C
- · Product contacting materials compliant to FDA
- · Sensor completely made of stainless steel

Features/Advantages

- · Short reaction time, very compact measurement point
- Material 1.4435, inspection certificate 3.1 included in delivery (for procuct contacting components)
- · Sensor e-polished $R_a < 0.8 \mu m$ (standard)
- · Integrated transmitter (optional)
- Different electrical connections available
- \cdot R_a < 0,4 µm or 0,6 µm (on request)

Options/Accessories

- · 2 x Pt100 (not retrofittable)
- · 2 x Pt100 with two transmitters (not retrofittable)
- \cdot Programmable transmitters MPU-4 and MPU-M with output 4...20 mA, 2-wire
- · Integrated transmitters for Profibus PA and HART-protocol
- · Programming adapter MPU-P 9701
- · Integrated transmitter MPU-LCD with display in connecting head
- · Pt100 chip with other classes of accuracy (1/3B, 1/10B)
- · Material certificate according to EN10204-3.1 for build-in systems, e.g. EHG
- Spacer for permanent temperatures up to 250 °C
 Resistance on permanent temperature up to 600 °C (on request)
- · Pre-assembled connecting cable for M12 plug
- · Fixed cable in other lengths and other material available
- · Calibration certificate (optional with order)

Authorizations





Temperature sensor TFP-42P



Temperature sensor TFP-162P with transmitter MPU-M



2

Temperature sensor				
Process connection	thread	M12 CLEANadapt; combined with Negele weld-in sleeves, build-in-systems, adapter sleeves		
Tightening torque	10 Nm			
Insertion length	standard	17 mm (special length up to 40 mm possible)		
Materials	connecting head thermowell	stainless steel 1.4305 stainless steel 1.4435		
Operating pressure		50 bar maximum		
Temperature ranges	ambient sensor tip	-50+80 °C -50+250 °C		
Sensing resistor	acc. to DIN EN 60751	Pt100		
Electrical connection	cable gland cable connection fixed cable 2.5 m fixed cable 2.5 m (≥ 90 °C)	M16 x 1.5 M12-plug 1.4305, 4-pins LIYY 4 x 0.25 mm ² PTFE 4 x 0.14 mm ²		
Protection class		IP 69 K (with electrical connection M12-plug)		

Transmitter MPU-4, MPU-10, MPU-H, MPU-M				
Temperature ranges	ambient storage	-40+85 °C -55+90 °C		
Measuring ranges	MPU-4, MPU-H, MPU-M	standard: -1040 °C, 050 / 100 / 150 / 200 °C special ranges free programable standard: -200850 °C configuration occurs with Profibus		
Accuracy	input	< ±0.25 °C		
Temperature drift	zero, span	< 0.01 % / K		
Supply	MPU-M, MPU-4 MPU-10 accuracy	835 V DC 932 V DC 0.01 % / V (reference: 12 V DC)		
Output	signal accuracy burden	analog 420 mA (not for MPU-10) < ± 0.1 % of measurement range < 600Ω (at U _B = 24 V)		
Humidity	without condensation	098 %		

Accuracy classes of temperature sensors Tolerances for Pt100 acc. to DIN EN 60751					
Pt100	A	1/3 B	1/10 B		
0°C/100Ω	±0.15 K / ±0.06 Ω	±0.10 K / ±0.04 Ω	±0.03 K / ±0.01 Ω		
100 °C / 138.5 Ω	±0.35 K / ±0.13 Ω	±0.27 K / ±0.10 Ω	±0.08 K / ±0.03 Ω		

Electrical Connection PHARMA

Electrical connection without transmitter

With 1 x M12 plug

3


Configuration 1st M12 plug

3 4

Electrical connection with transmitter

With M12 plug


Configuration M12 plug



1: + supply

2: - supply 4...20 mA 3: not connected


With 2 x M12 plug



Configuration 2nd M12 plug




With cable gland

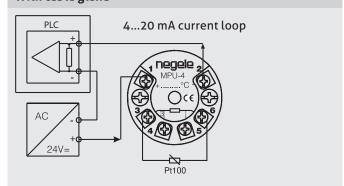

With cable gland


Configuration strip terminal

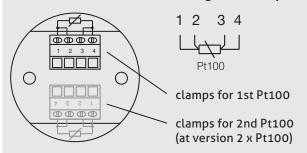

Electrical connection with two transmitter (TFP-62P)

With 1 x M12-plug (sensor 1 + sensor 2)

Configuration M12-plug



1: + supply (sensor 1)

2: - supply 4...20 mA (sensor 1) 3: - supply 4...20 mA (sensor 2)

4: + supply (sensor 2)

With fixed cable




Fixed cable connection with 1 x Pt100

wh ye bn gn standard rd rd wh wh PTFE

With 2 x M12-plug (sensor 1)

Configuration M12-plug



1: + supply (sensor 1)

2: - supply 4...20 mA (sensor 1)

3: not connected

4: not connected

Fixed cable connection with 2 x Pt100 (LIYY)

wh ye bn gn 1st Pt100 pk gy 2nd Pt100 rd bu




Fixed cable connection with 2 x Pt100 (PTFE)

wh 1st Pt100 rd rd ye 2nd Pt100



With 2 x M12-plug (sensor 2)

Configuration M12-plug





1: + supply (sensor 2)


2: - supply 4...20 mA (sensor 2)

3: not connected

4: not connected

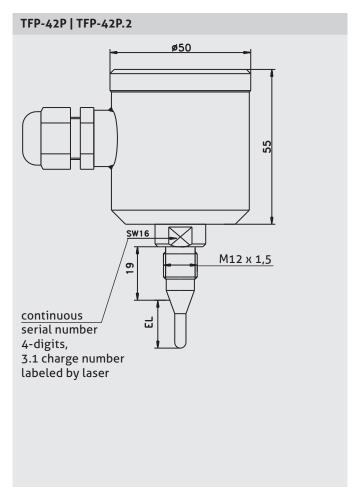

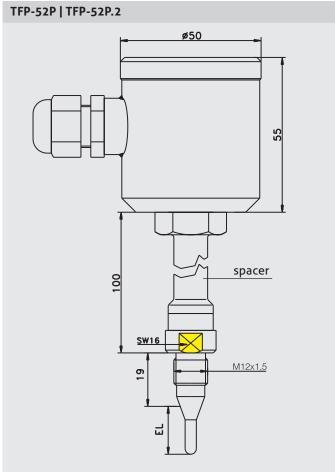


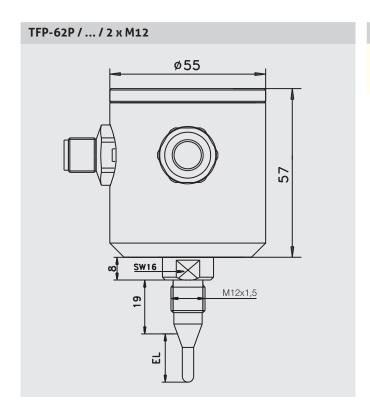



Important installation advice



Tighten the sensor only at the lower spanner flat (WW16)!

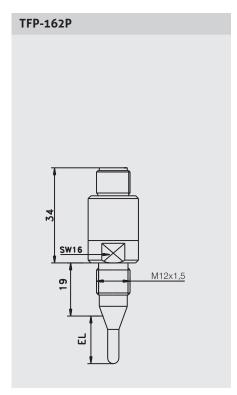


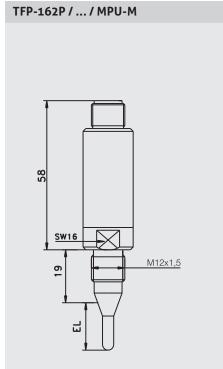

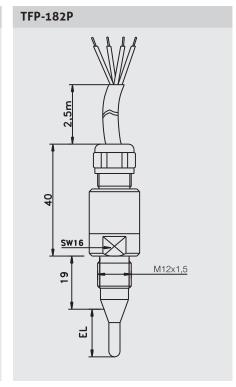

Sensor tip diameter and response time

The below-mentioned times were measured by emersing a temperature sensor from room temperature into boiling water.

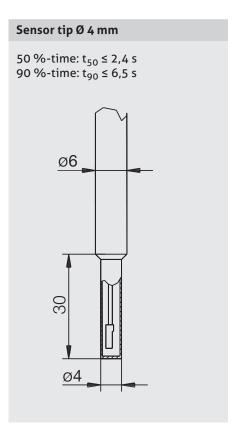

Mechanical Connection / Installation



 Use only Negele CLEANadapt system for safe operation of measuring point!

Intended usage



- · Not suitable for applications in explosive areas.
- Not suitable for applications in security-relevant equipments (SIL).

Transport/Storage



- No outdoor storage
- · Dry and dust free
- · Not exposed to corrosive media
- · Protected against solar radiation
- · Avoiding mechanical shock and vibration
- Storage temperature -55...+90 °C
- · Relative humidity maximum 98 %

Reshipment



- Sensors shall be clean and must not be contaminated with dangerous media!
- Use suitable transport packaging only to avoid damage of the equipment!

Cleaning/Maintenance



 In case of using pressure washers, dont't point nozzle directly to electrical connections!

Standards and guidelines



You have to comply with applicable regulations and directives.

Disposal



- This instrument is not subject to the WEEE directive 2002/96/EC and the respective national laws.
- Pass the instrument directly on to a specialised recycling company and do not use the municipal collecting points.

Advice to EMC



- The device agrees to following standards: EMC directive 2004/108/EC.
- You have to guarantee the EMC directives for the entire equipement.

Temperature Transmitter MPU-LCD with Display

Application/Specified usage

- \cdot 4...20mA transmitter with LCD for Pt100 temperature sensor
- · For installation in temperature sensor
- · Sensor monitoring

Features

- $\cdot\,$ 4-digit display with green backlight
- \cdot Temperature measurement in °C and °F
- · Easy range select by one button
- · Lower costs for wiring because of 2-wire technology

Note



See product information "MPU-LCD" for details.



Order Code PHARMA

Order code for version with 1 x Pt100; inclusive 3.1 certificate TFP-42P (sensor with connecting head Ø 50 mm, non-sensitive design to vibrations) TFP-52P sensor with connecting head Ø 50 mm, non-sensitive design to vibrations, with spacer) **TFP-162P** (sensor with connecting head Ø 18 mm, electrical connection M12 plug) TFP-182P (sensor with connecting head Ø 18 mm, electrical connection 2,5 m PTFE-cable, other lengths: see at accessories) Sensor length EL in mm 017 special length (up to 40 mm maximal) XXX Diameter sensor tip in mm 4 6 (on request) **Accuracy class Pt100** 1/3B 1/10B Electrical connection (not selectable at TFP-162P and -182P) PG (cable gland M16x1,5) (M12-plug, standard with MPU-LCD) M12 Transmitter Х (without) for TFP-42P and -52P MPU-4 (programmable) MPU-10 (Profibus PA) MPU-H (HART-protocol) MPU-LCD (with display) only for TFP-162P MPU-M (programmable) Measuring range MPU (only for types with transmitter; not for MPU-LCD) -10...40 (measurement range -10...40 °C) 0...50 (measurement range 0...50 °C) 0...100 (measurement range 0...100 °C) 0...150 (measurement range 0...150 °C) 0...200 (measurement range 0...200 °C) (special range) хх...уу TFP-42P/ PG/ **MPU-4/** 017/ 6/ **A**/ 0...100

Accessories

PVC-cable with M12-connection made of 1.4305, IP 69 K, unshielded M12-PVC / 4-5 m

PVC-cable 4-pin, length 5 m

M12-PVC / 4-10 m PVC-cable 4-pin, length 10 m M12-PVC / 4-25 m PVC-cable 4-pin, length 25 m

PVC-cable with M12-connection, brass nickel-plated, IP 67, shielded

M12-PVC / 4G-5 m PVC-cable 4-pin, length 5 m
M12-PVC / 4G-10 m PVC-cable 4-pin, length 10 m
M12-PVC / 4G-25 m PVC-cable 4-pin, length 25 m

Programming adapter

MPU-P 9701 Programming adapter for MPU-4, MPU-H and MPU-M

Programming adapter MPU-P 9701

PVC-cable with M12-connection



Order code for version with 2 x Pt100; inclusive 3.1 certificate TFP-42P.2 (connecting head Ø 50 mm, 2 x Pt100, non-sensitive design to vibrations) TFP-52P.2 (connecting head Ø 50 mm, 2 x Pt100, non-sensitive design to vibrations, with spacer) TFP-62P (higher connecting head Ø 55 mm, 2 x Pt100, prepared for 2 x transmitter) TFP-62P-H (like TFP-62P, but with spacer) TFP-182P.2 (connecting head Ø 18 mm, electrical connection 2,5 m PTFE-cable; other lengths: see at accessories) Sensor length EL in mm 017 ххх special length (up to 40 mm maximal) Diameter sensor tip in mm 6 (on request) **Accuracy class Pt100** 1/3B 1/10B Electrical connection only for TFP-42P.2 and TFP-52P.2 (cable gland M16x1,5) 2 x PG (2 x cable gland M16x1,5) 2 x M12 (2 x M12-plug 1.4305) Electrical connection only for TFP-62P and TFP-62P-H M12 (M12-plug 1.4305) 2 x M12 (2 x M12-plug 1.4305) Continue if TFP-62P or TFP-62P-H is selected! No further options for TFP-42P.2, -52P.2 and -182P.2! 1st Transmitter MPU-4 (programmable) Measuring range 1st transmitter -10...40 (measurement range -10...40 °C) 0...50 (measurement range 0...+50 °C) 0...100 (measurement range 0...+100 °C) 0...150 (measurement range 0...+150 °C) 0...200 (measurement range 0...+200 °C) хх...уу (special range) **2nd Transmitter** MPU-4 (programmable) Measuring range 2nd transmitter -10...40 (range -10...40 °C) 0...50 (range 0...+50 °C) 0...100 (range 0...+100 °C) 0...150 (range 0...+150 °C) 0...200 (range 0...+200 °C) хх...уу (special range) MPU-4/ 0...50 TFP-62P / 017/ 4/ **A/** M12/ MPU-4/ 0...50/